

Silica[®] 21



Sensor

59MX2BW0...



59MX2BW1...



59MX2CW0...



59MX2CW1...

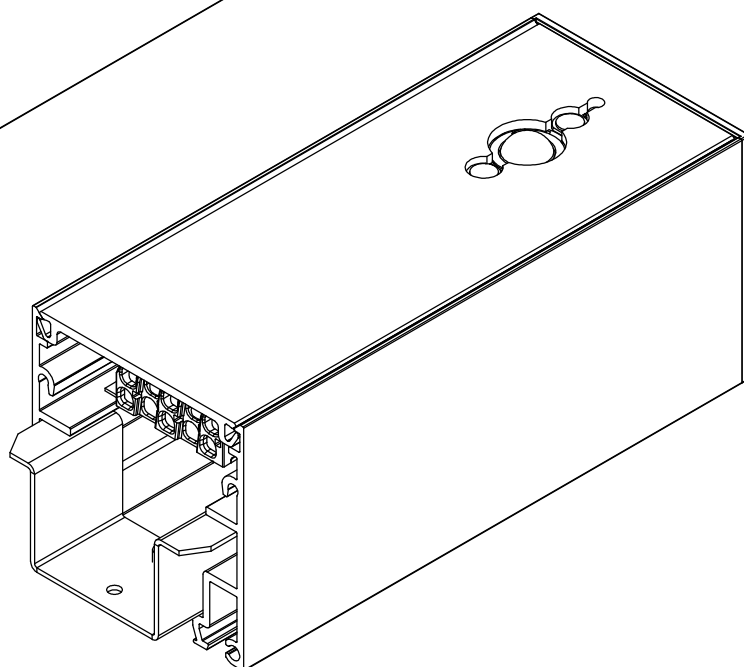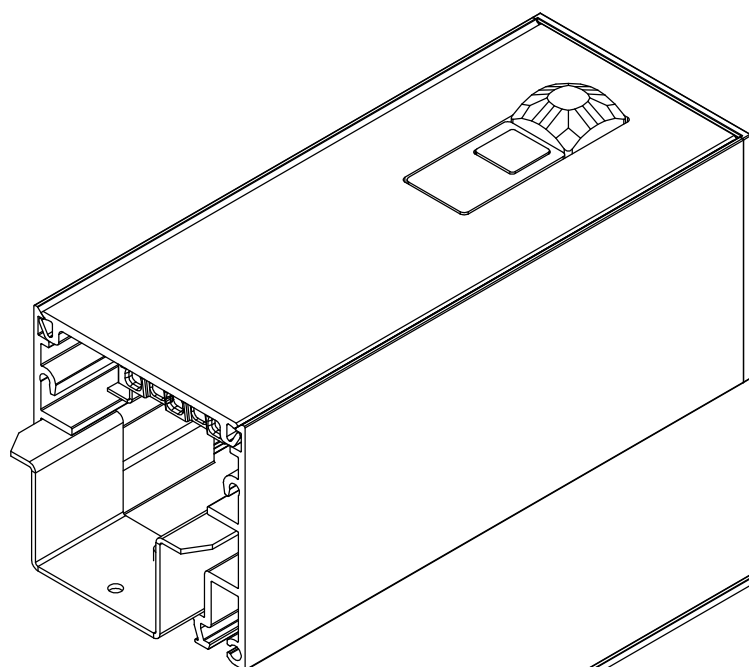


siteco

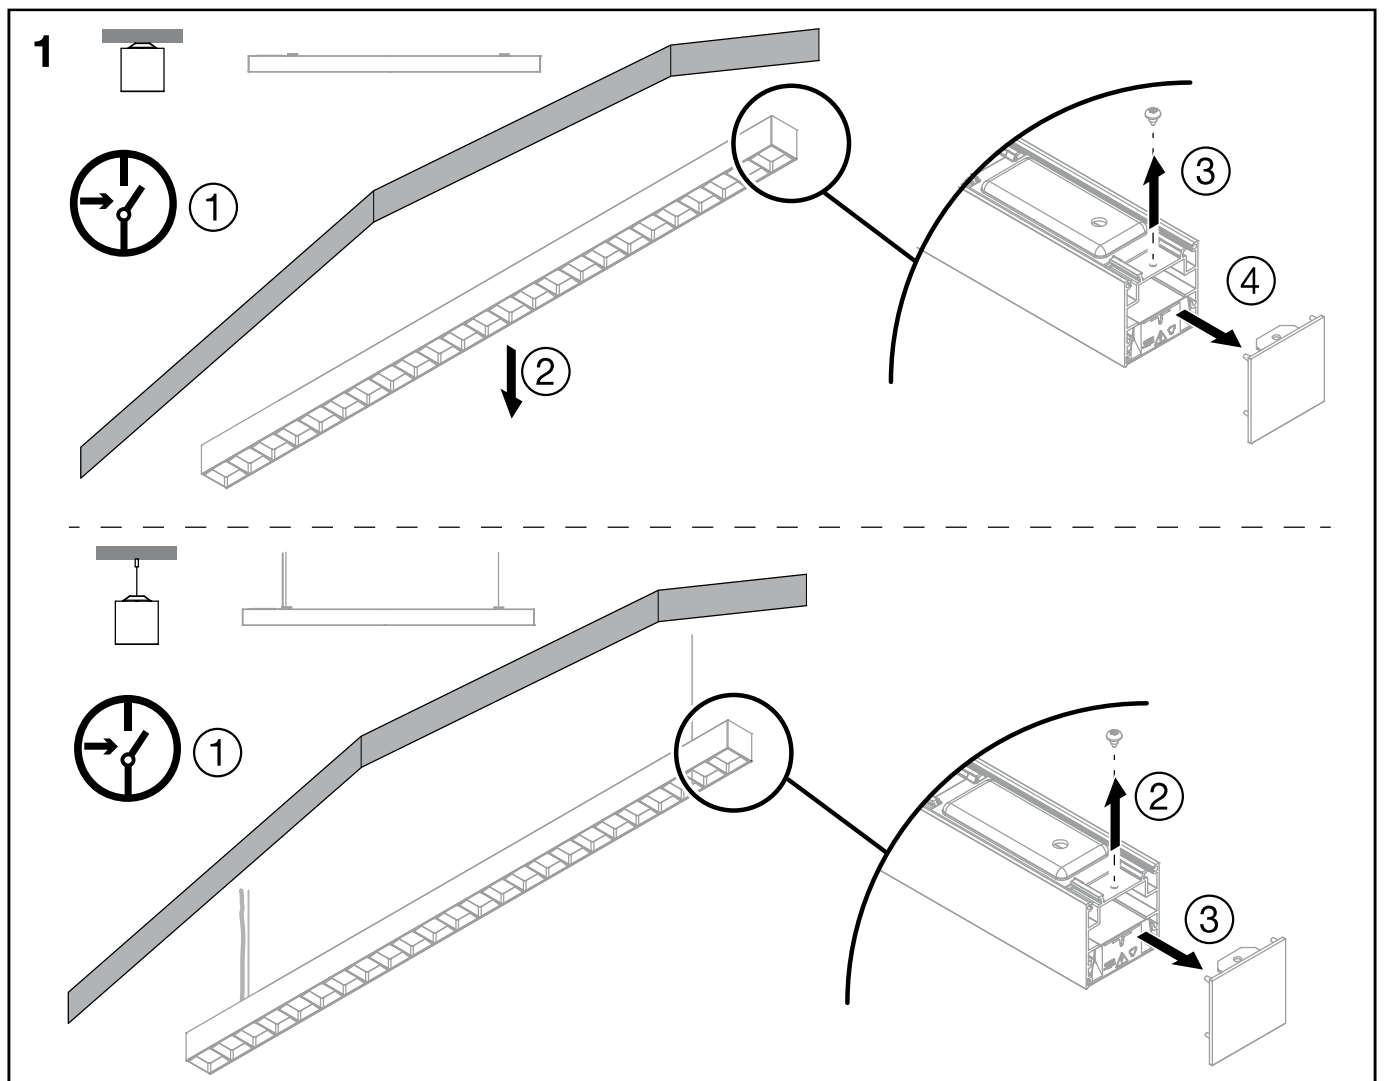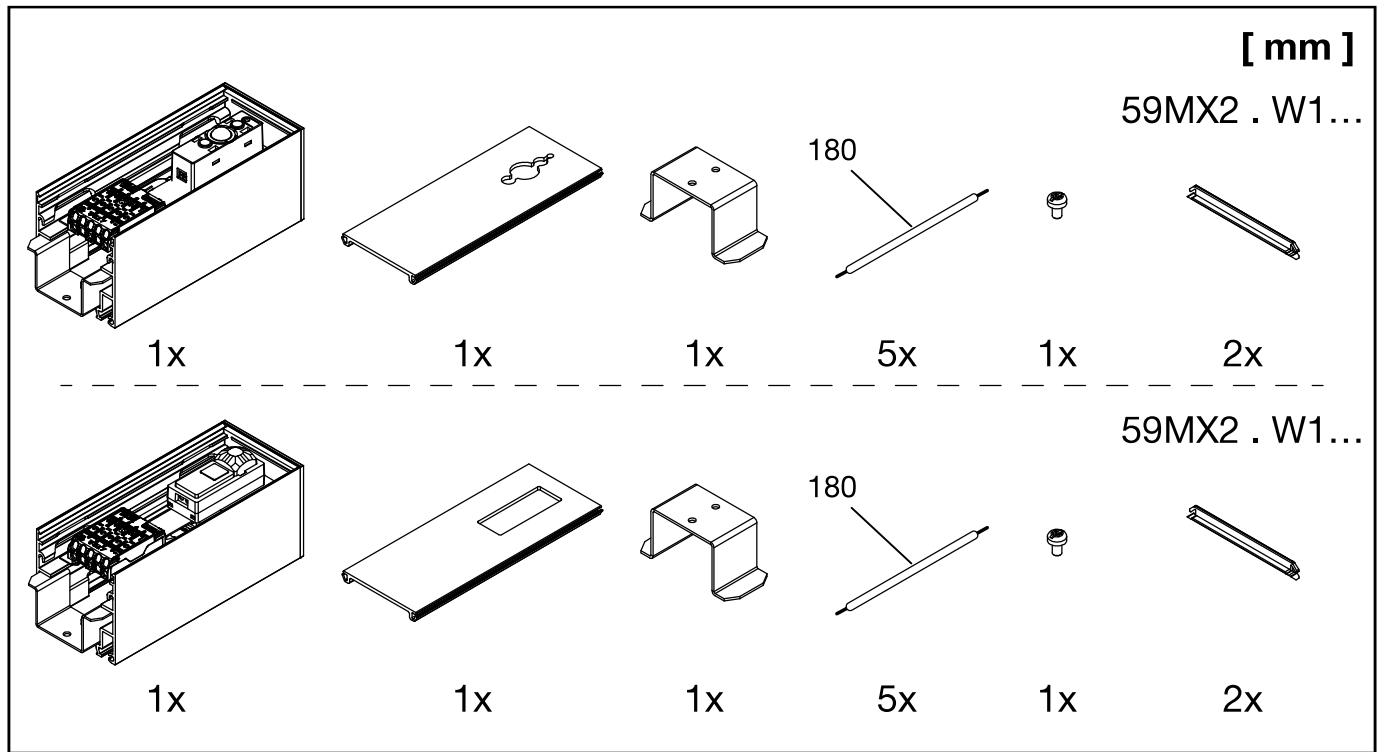

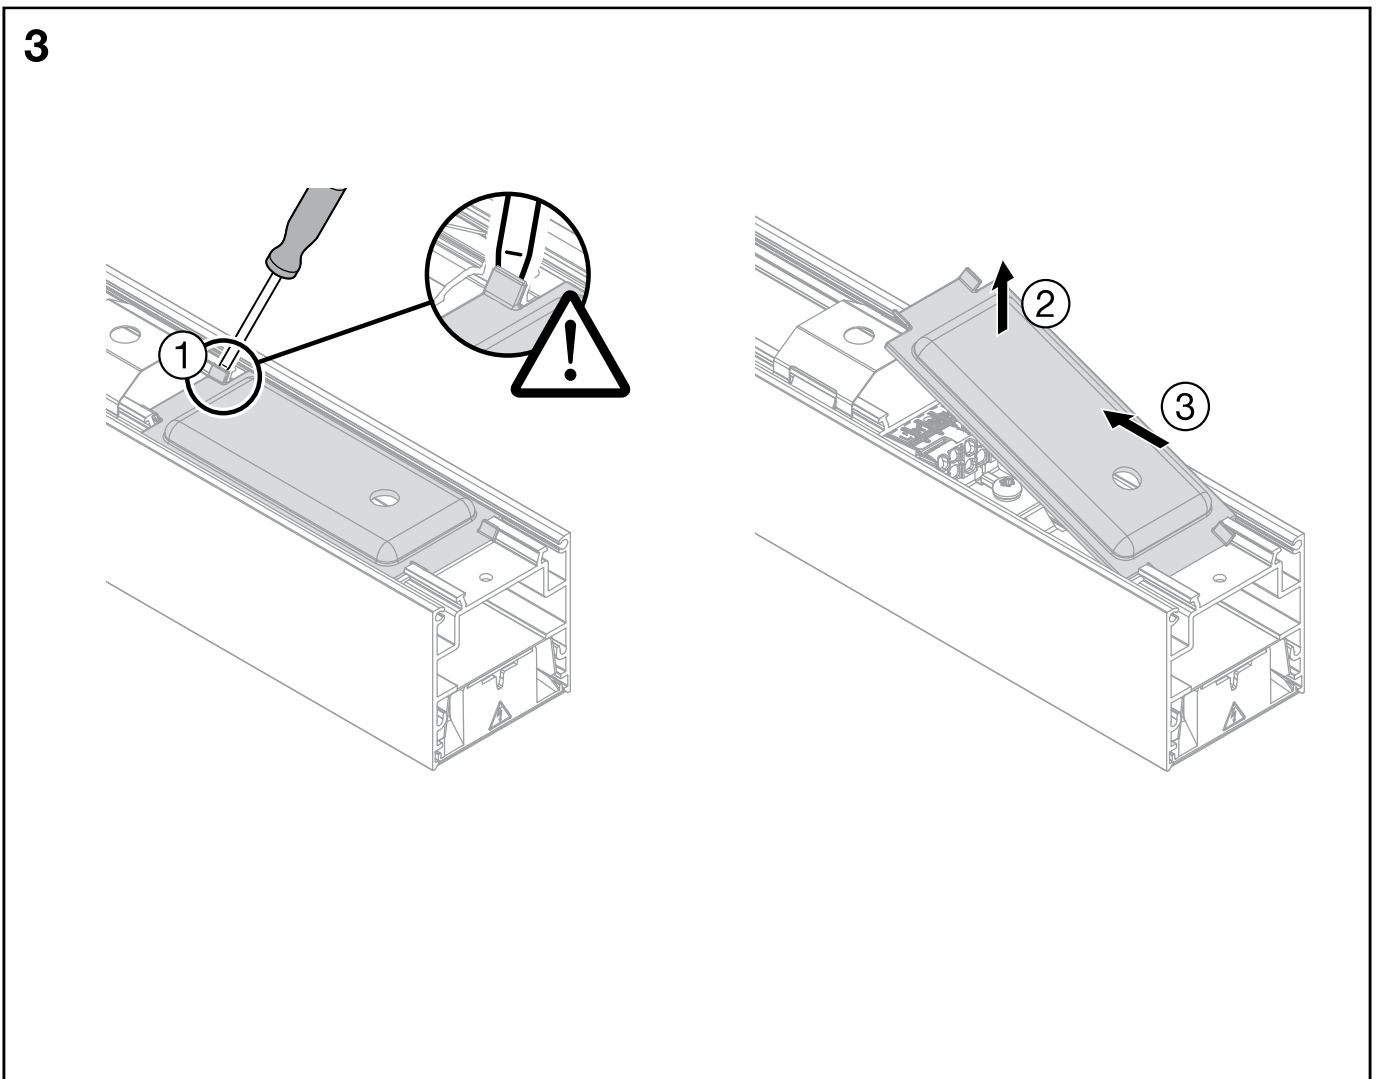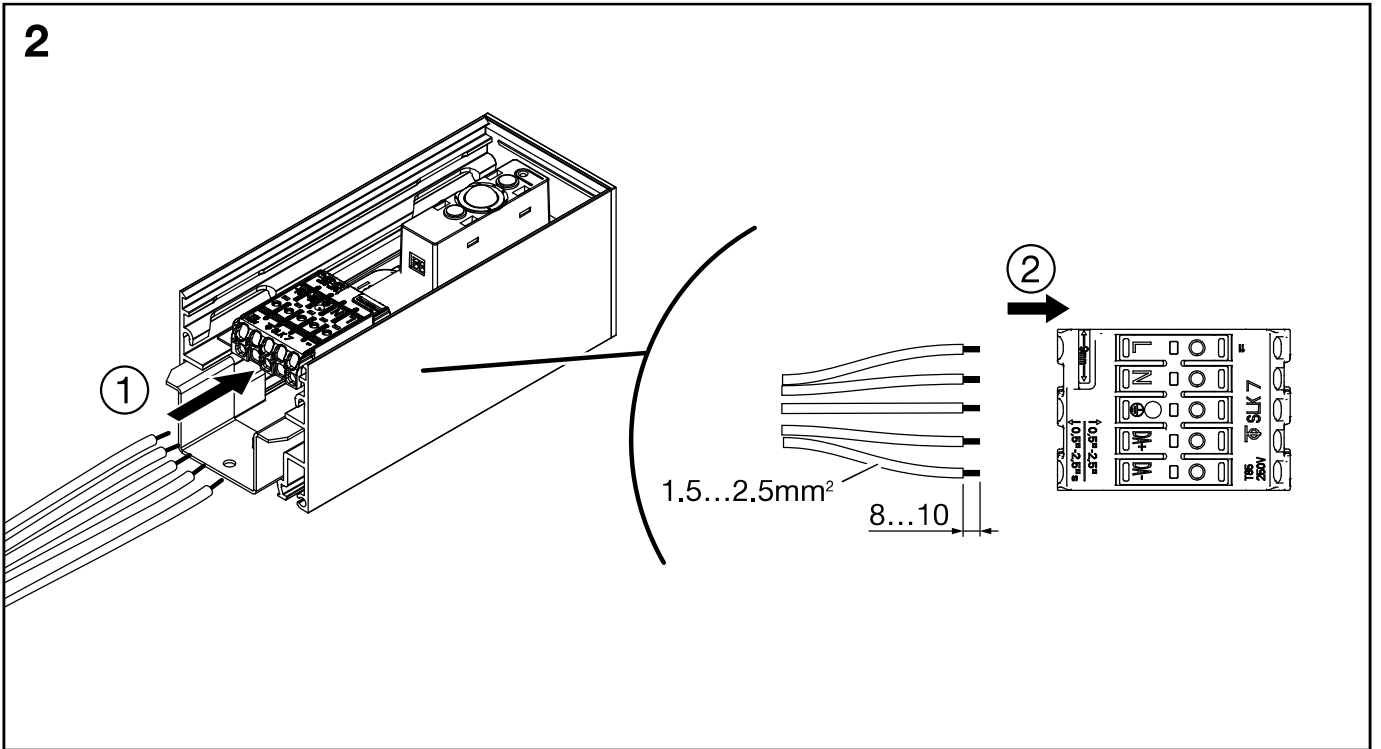


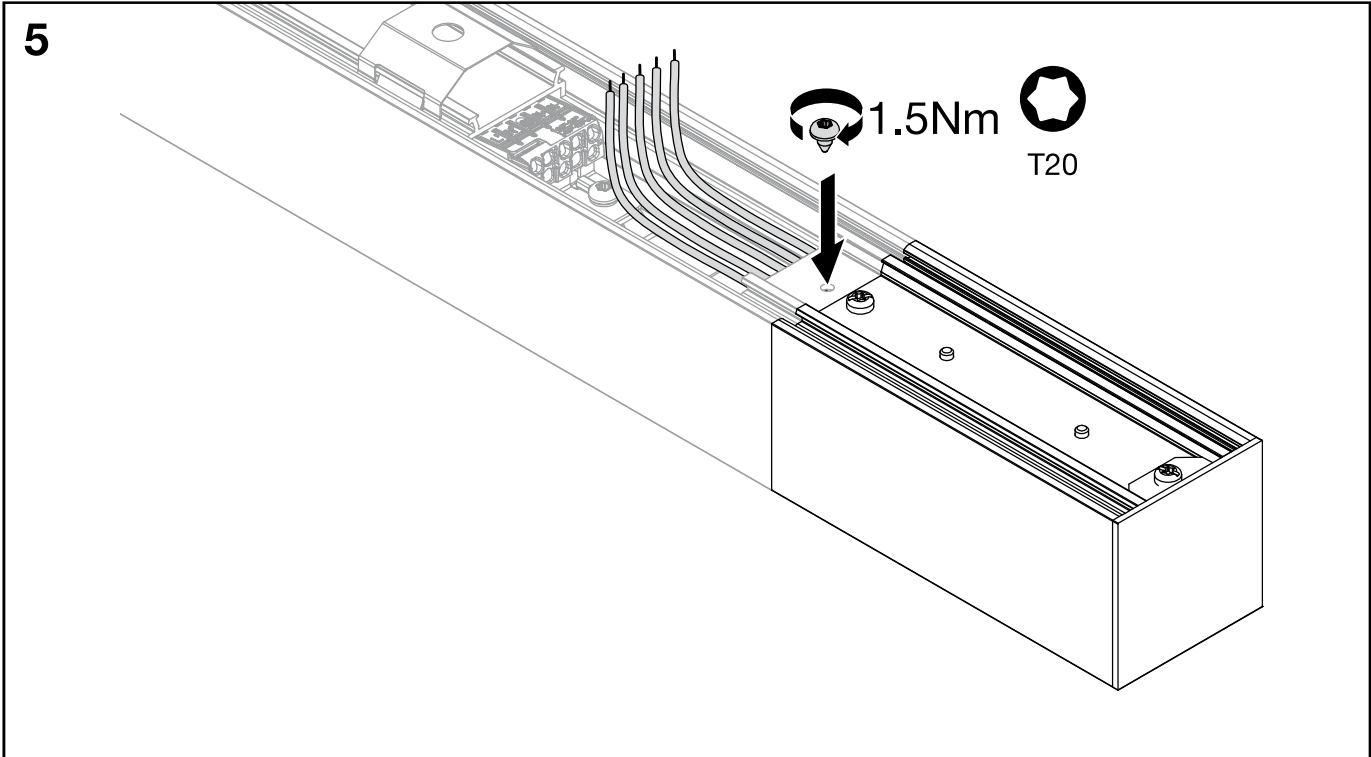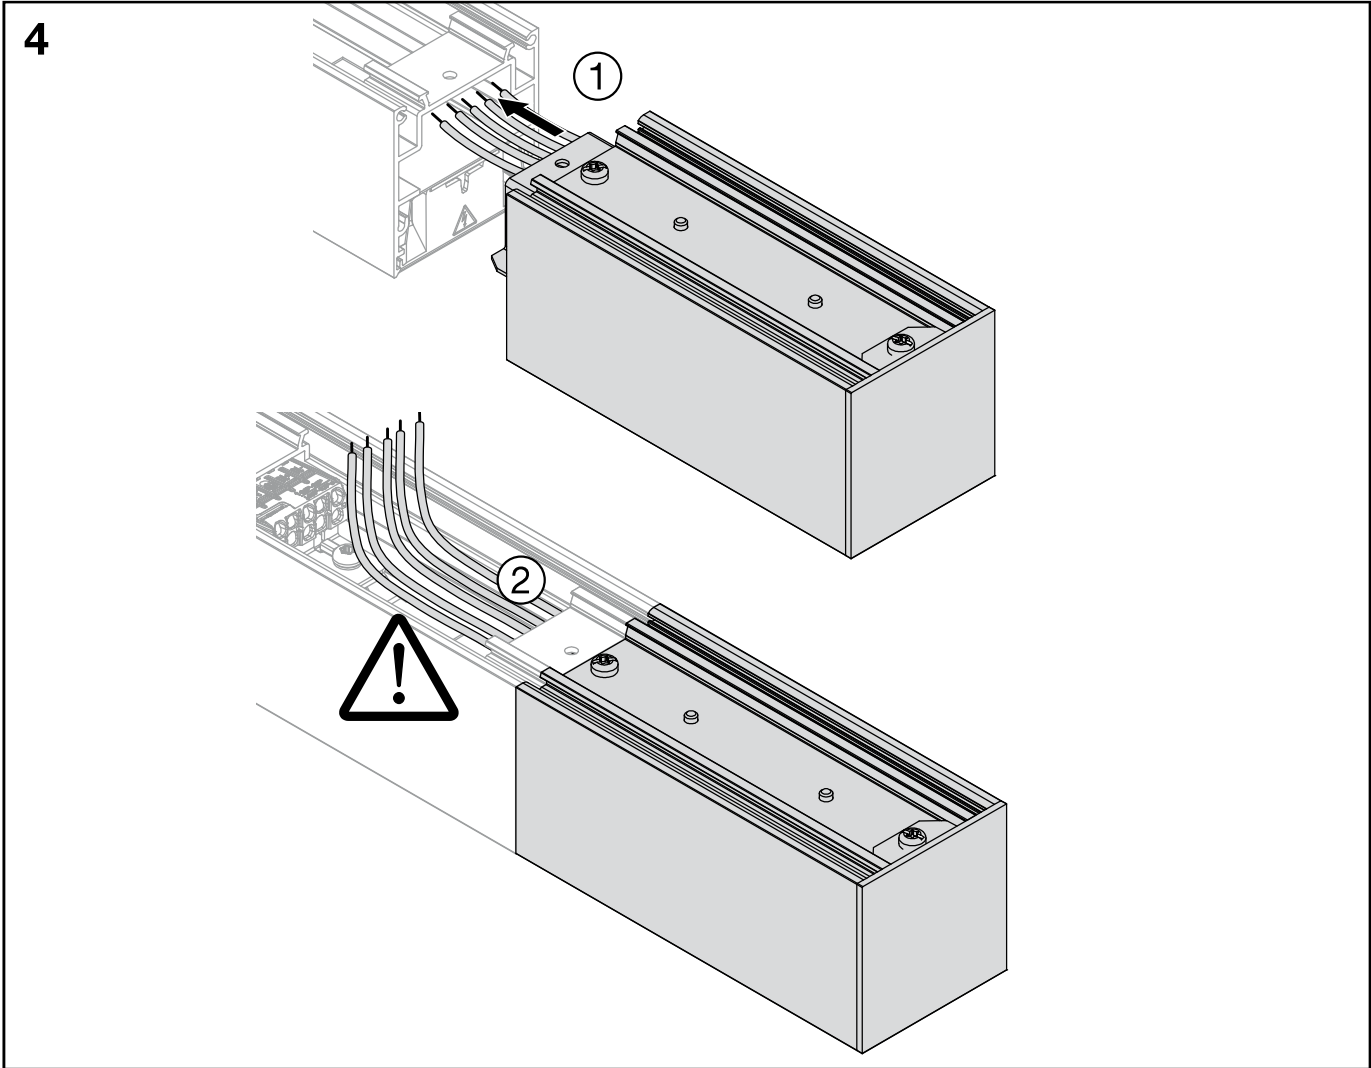


6a


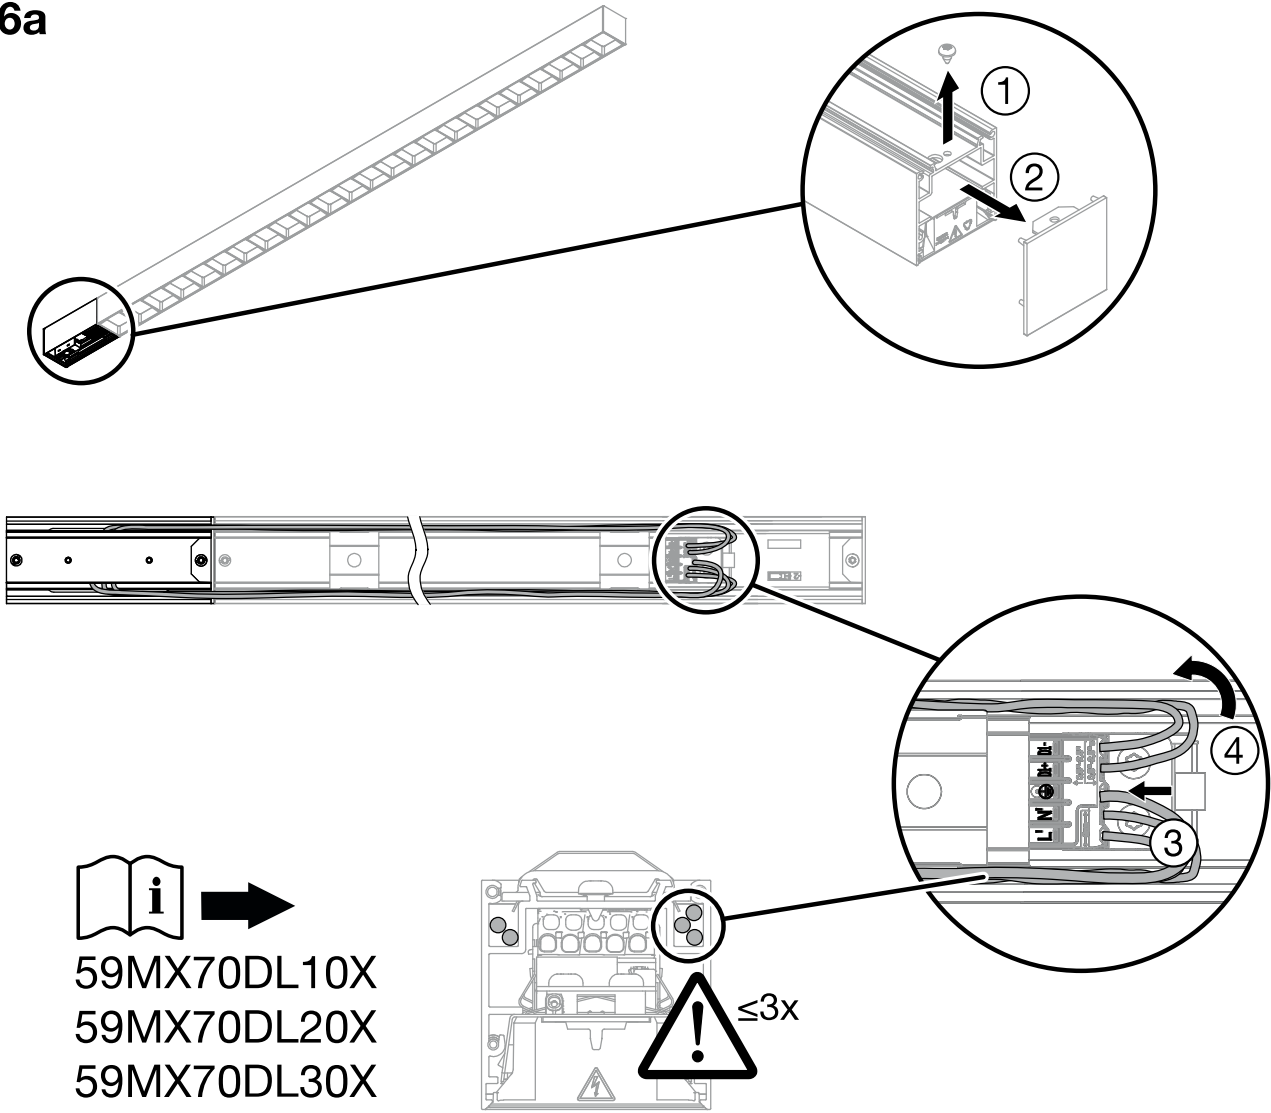



59MX70DL10X
59MX70DL20X
59MX70DL30X



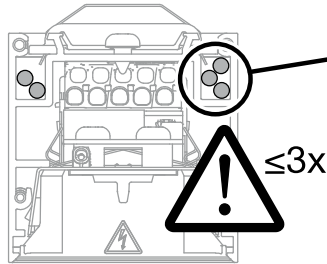


6b

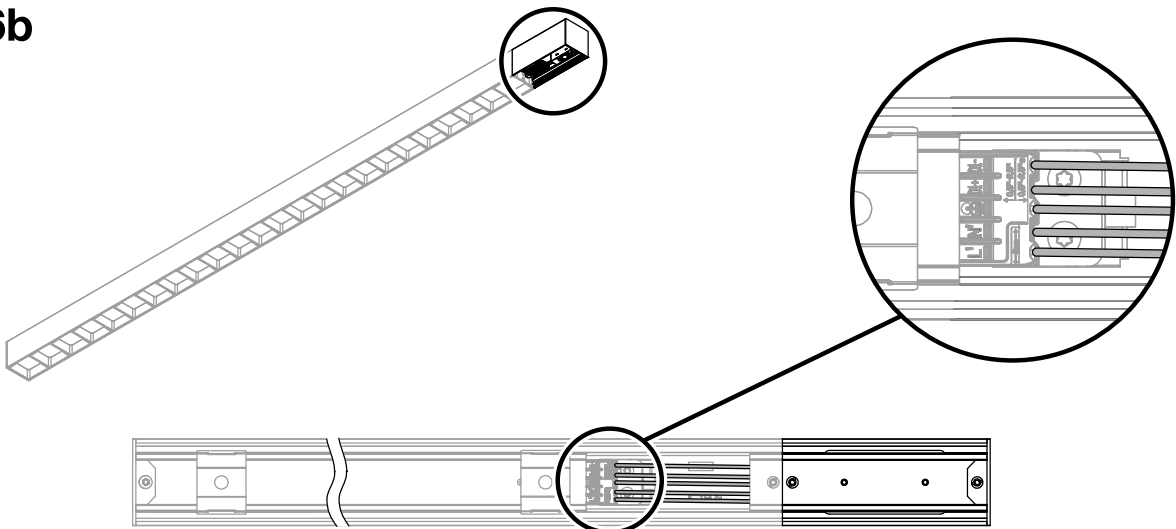


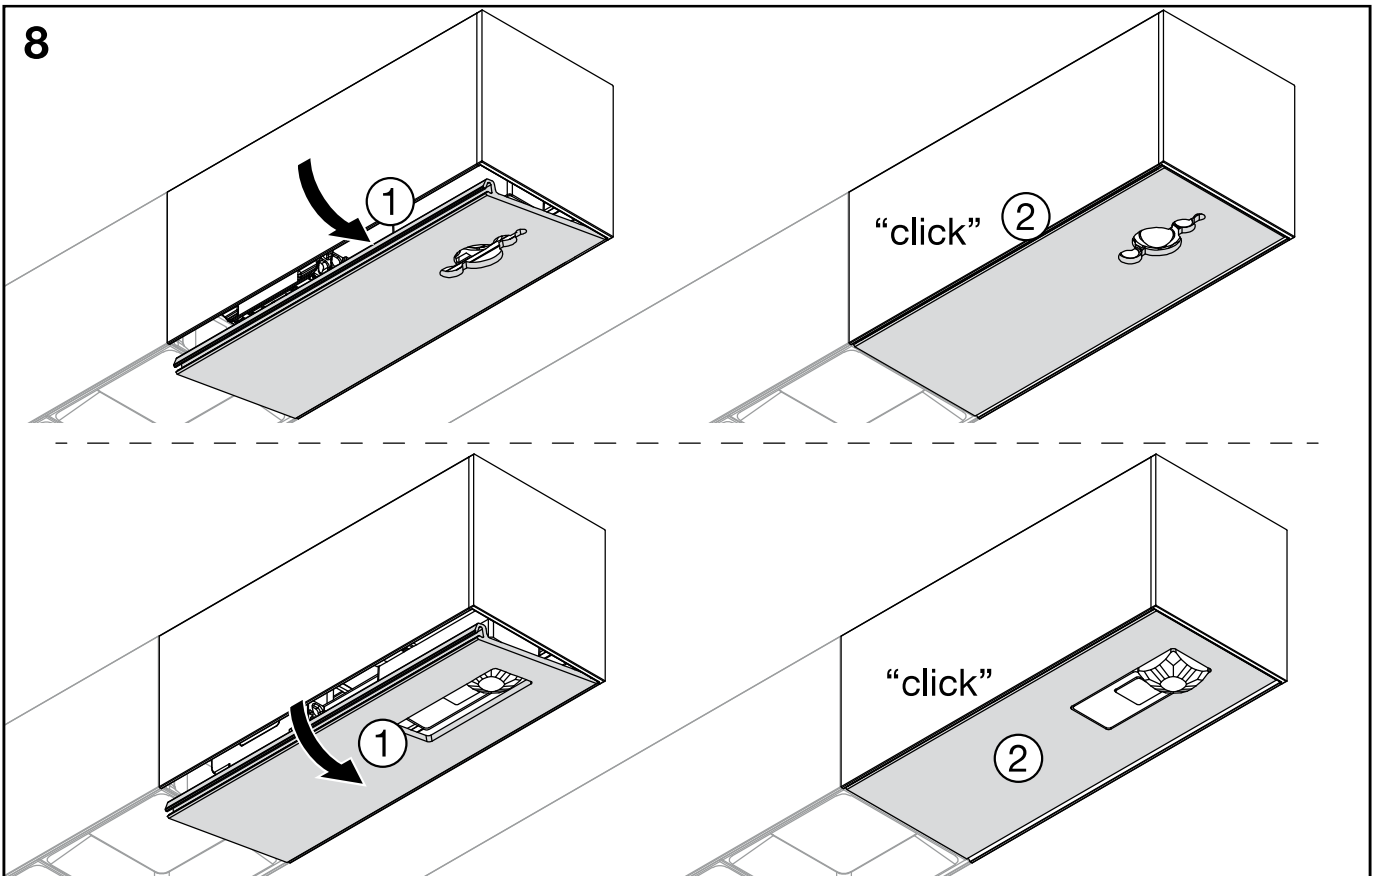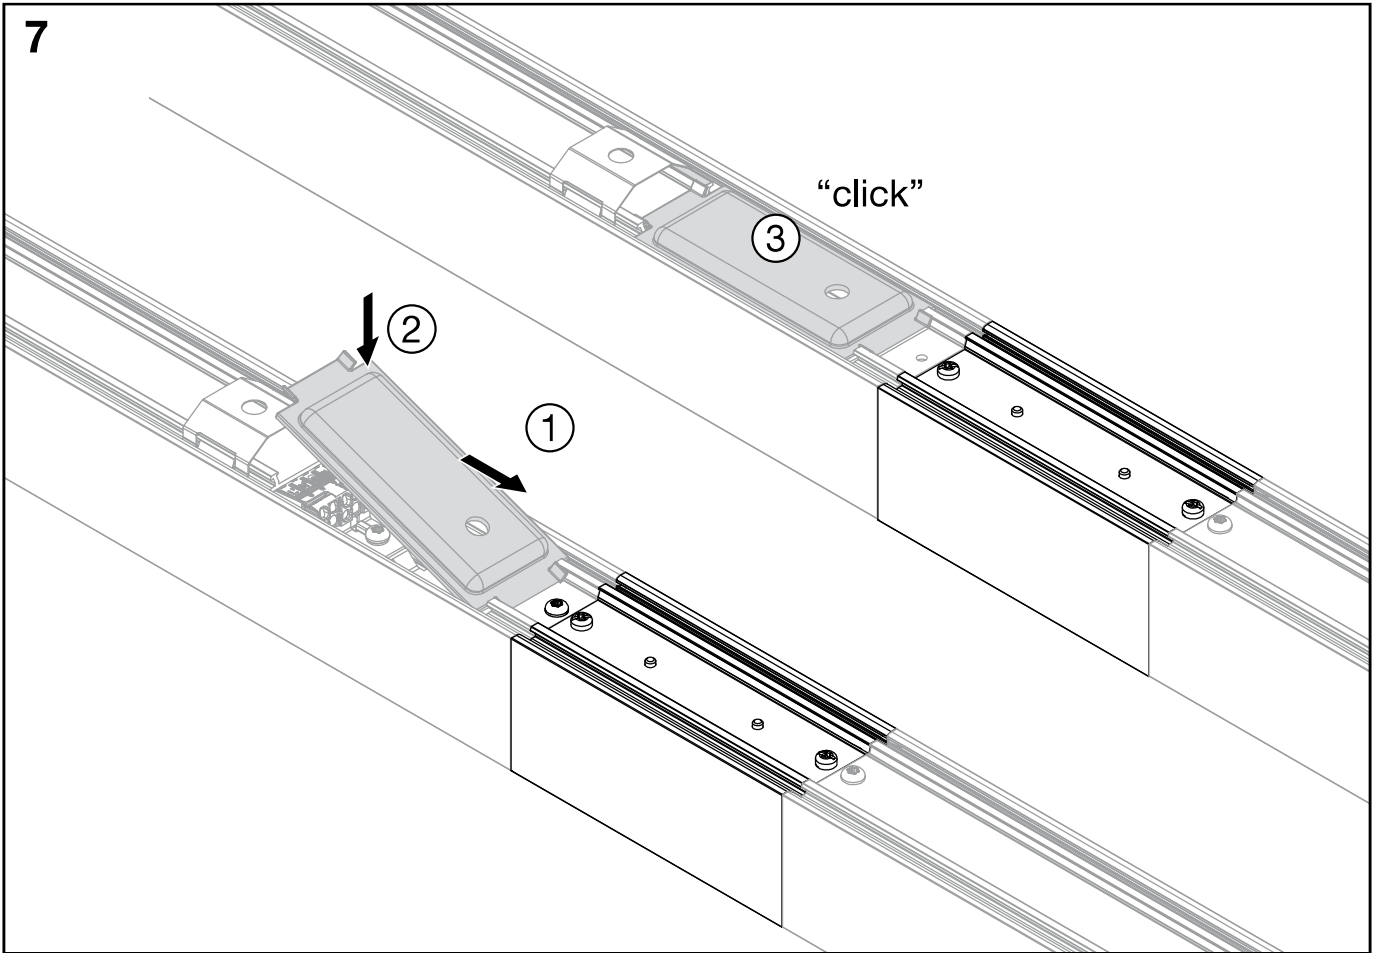

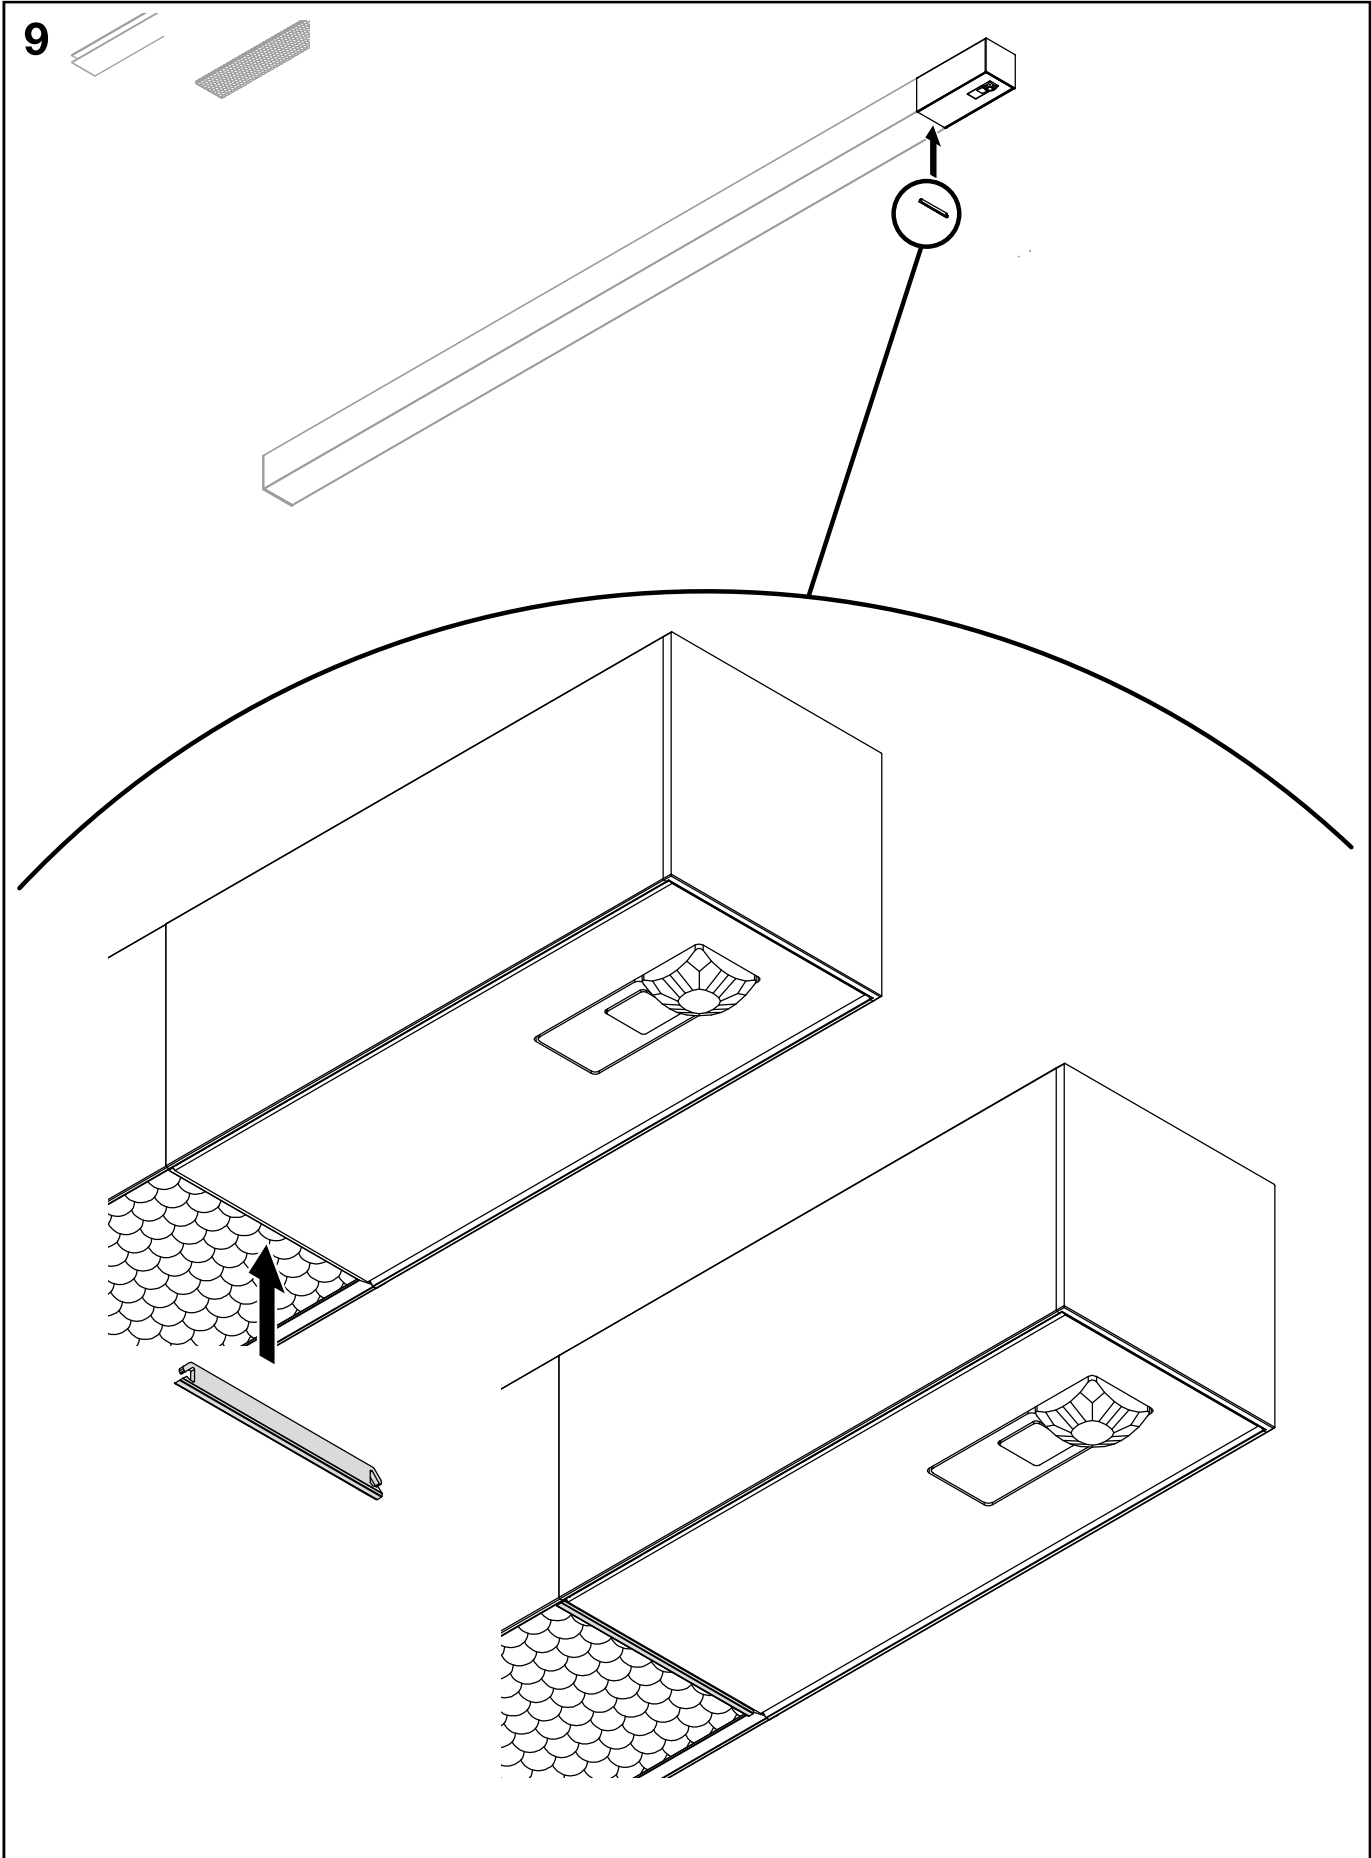


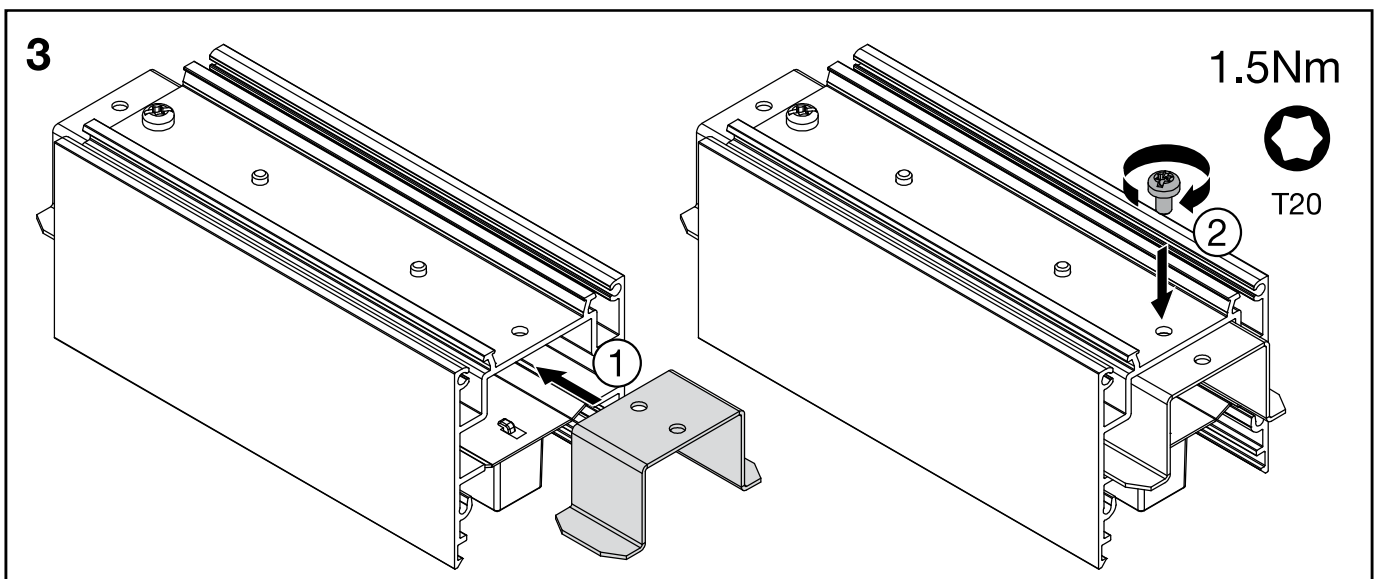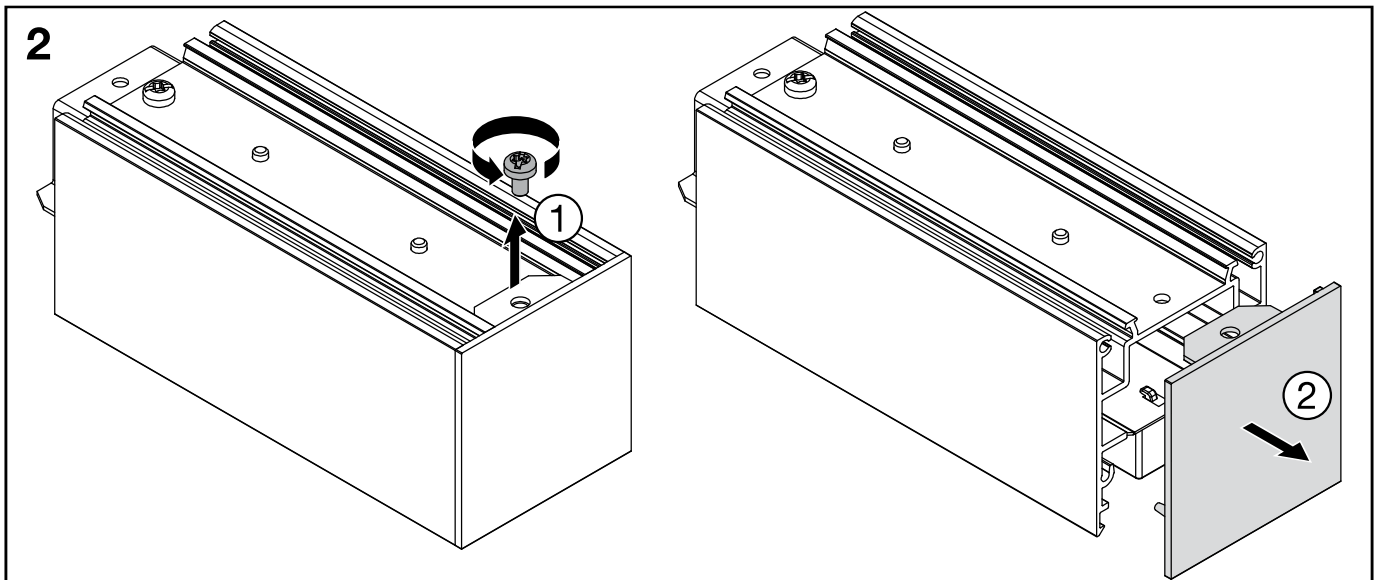
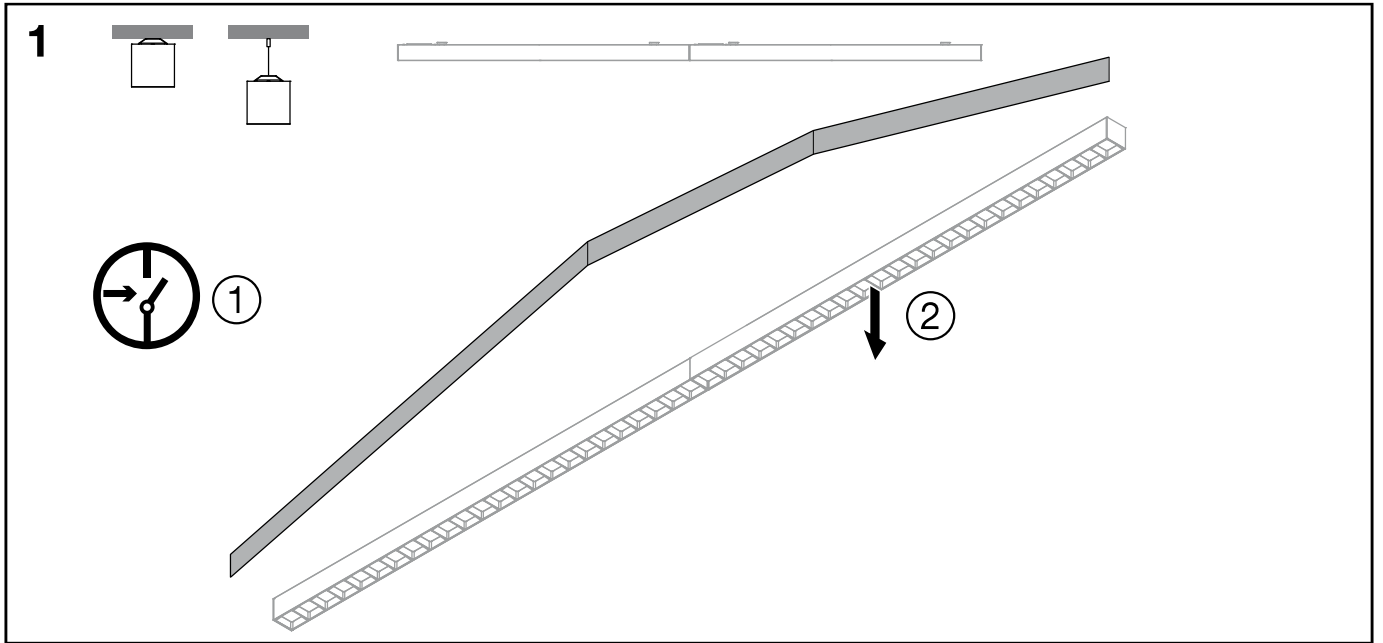



4

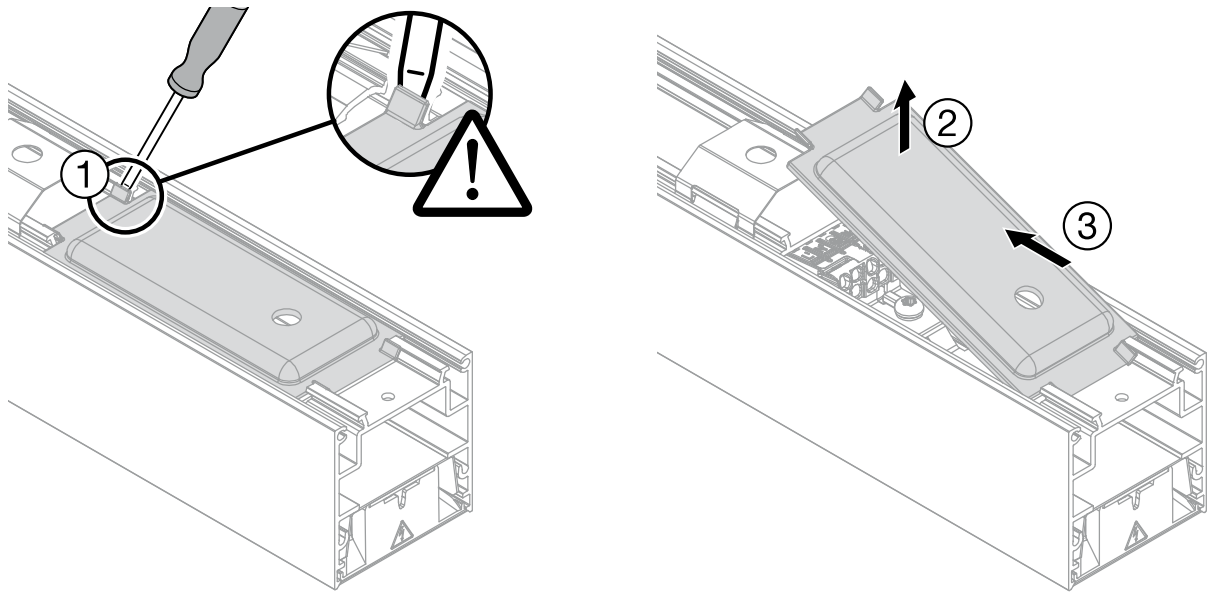

5

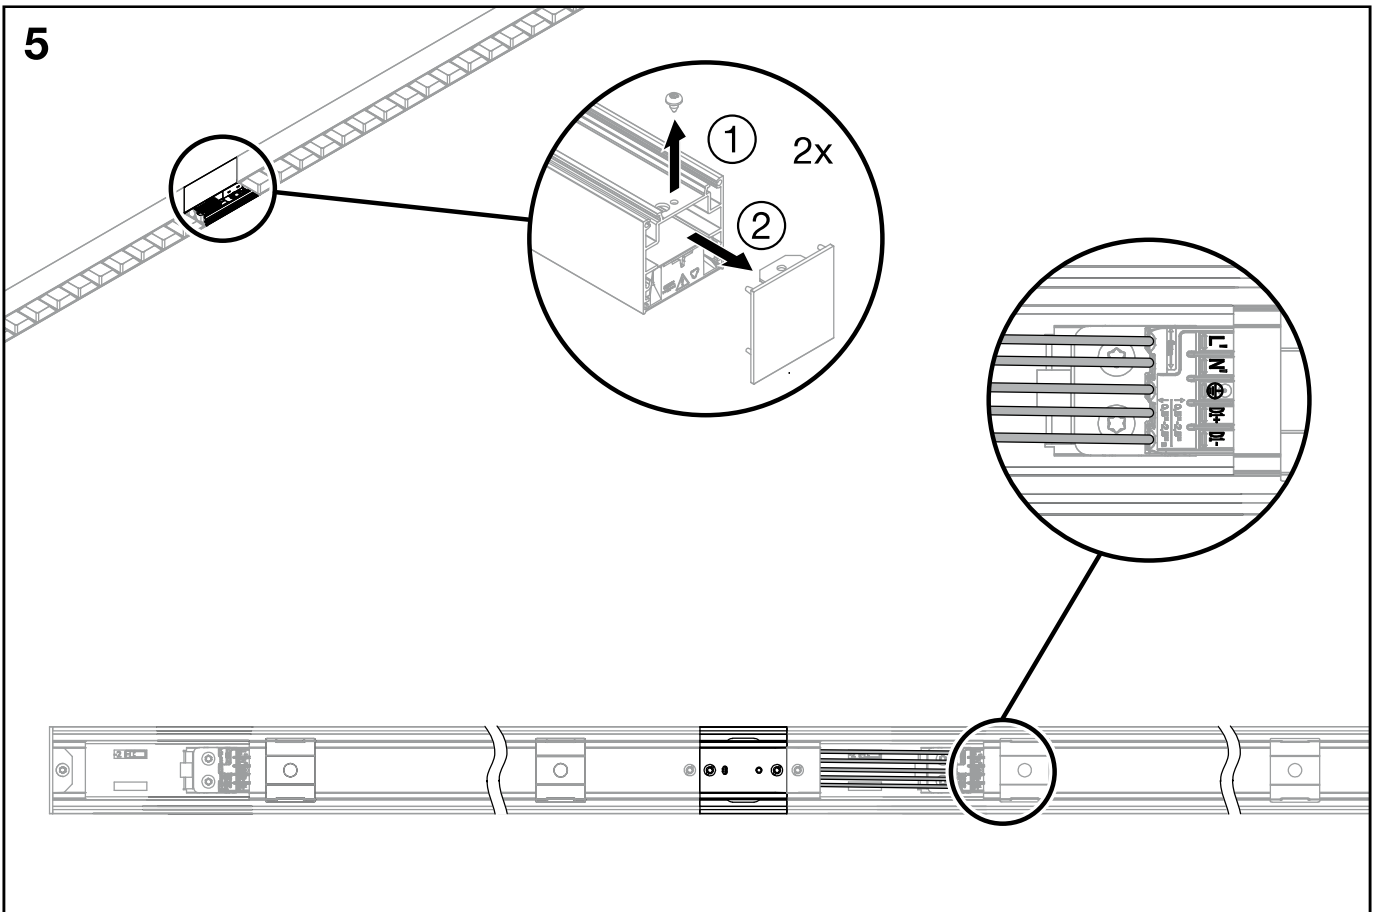

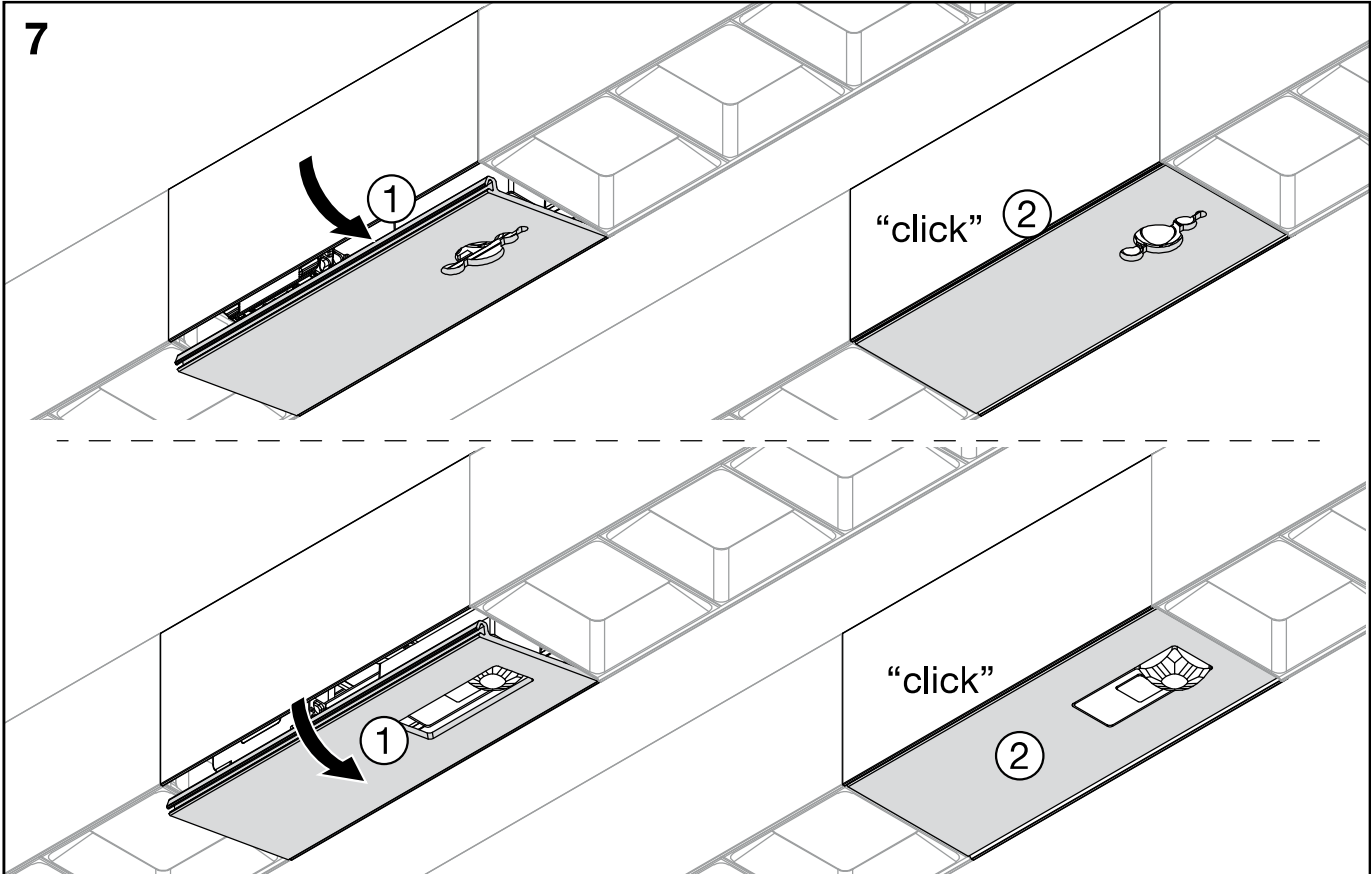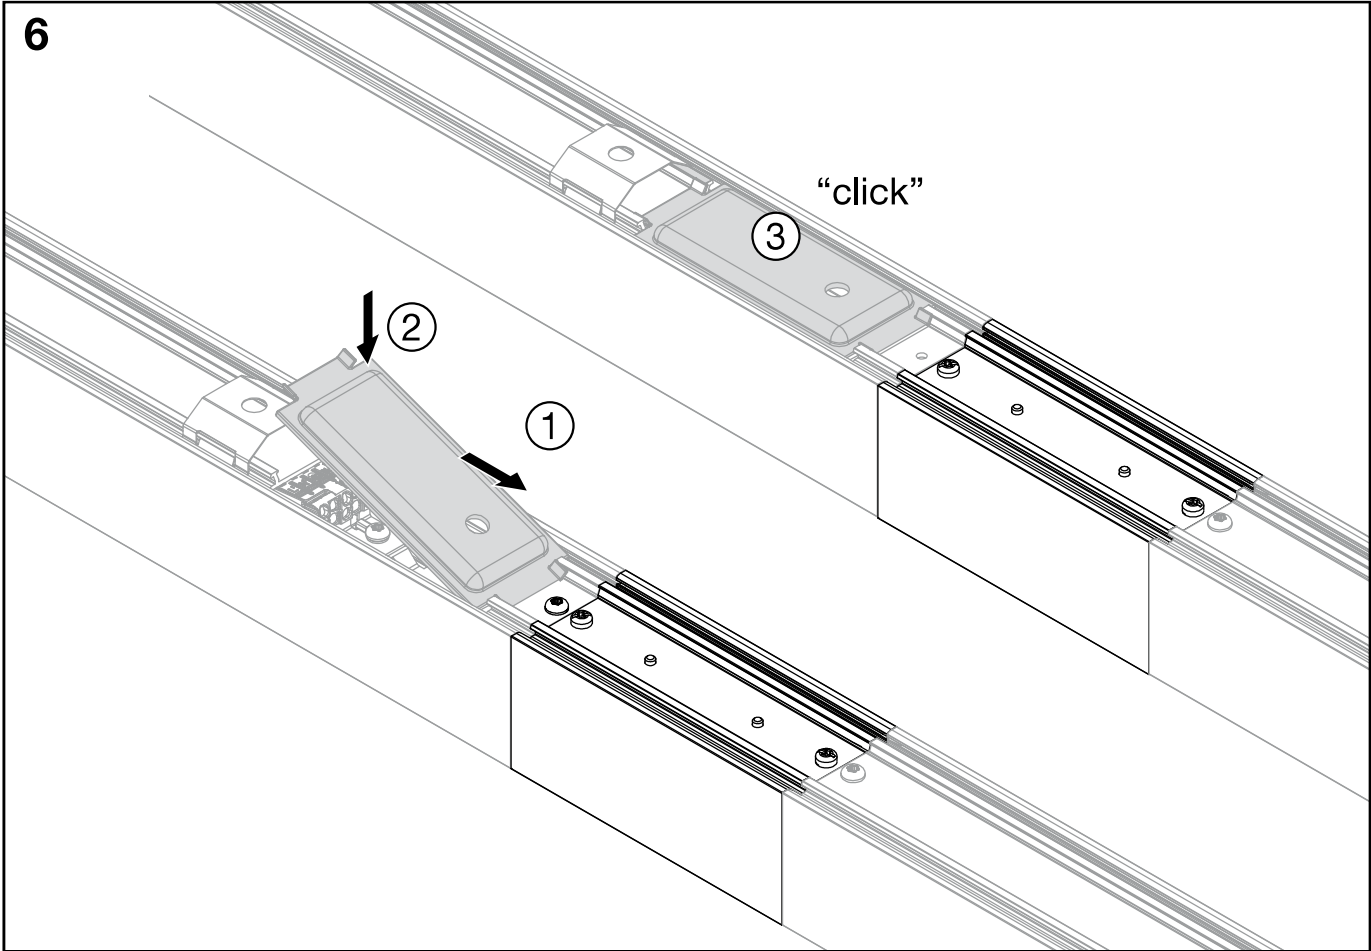

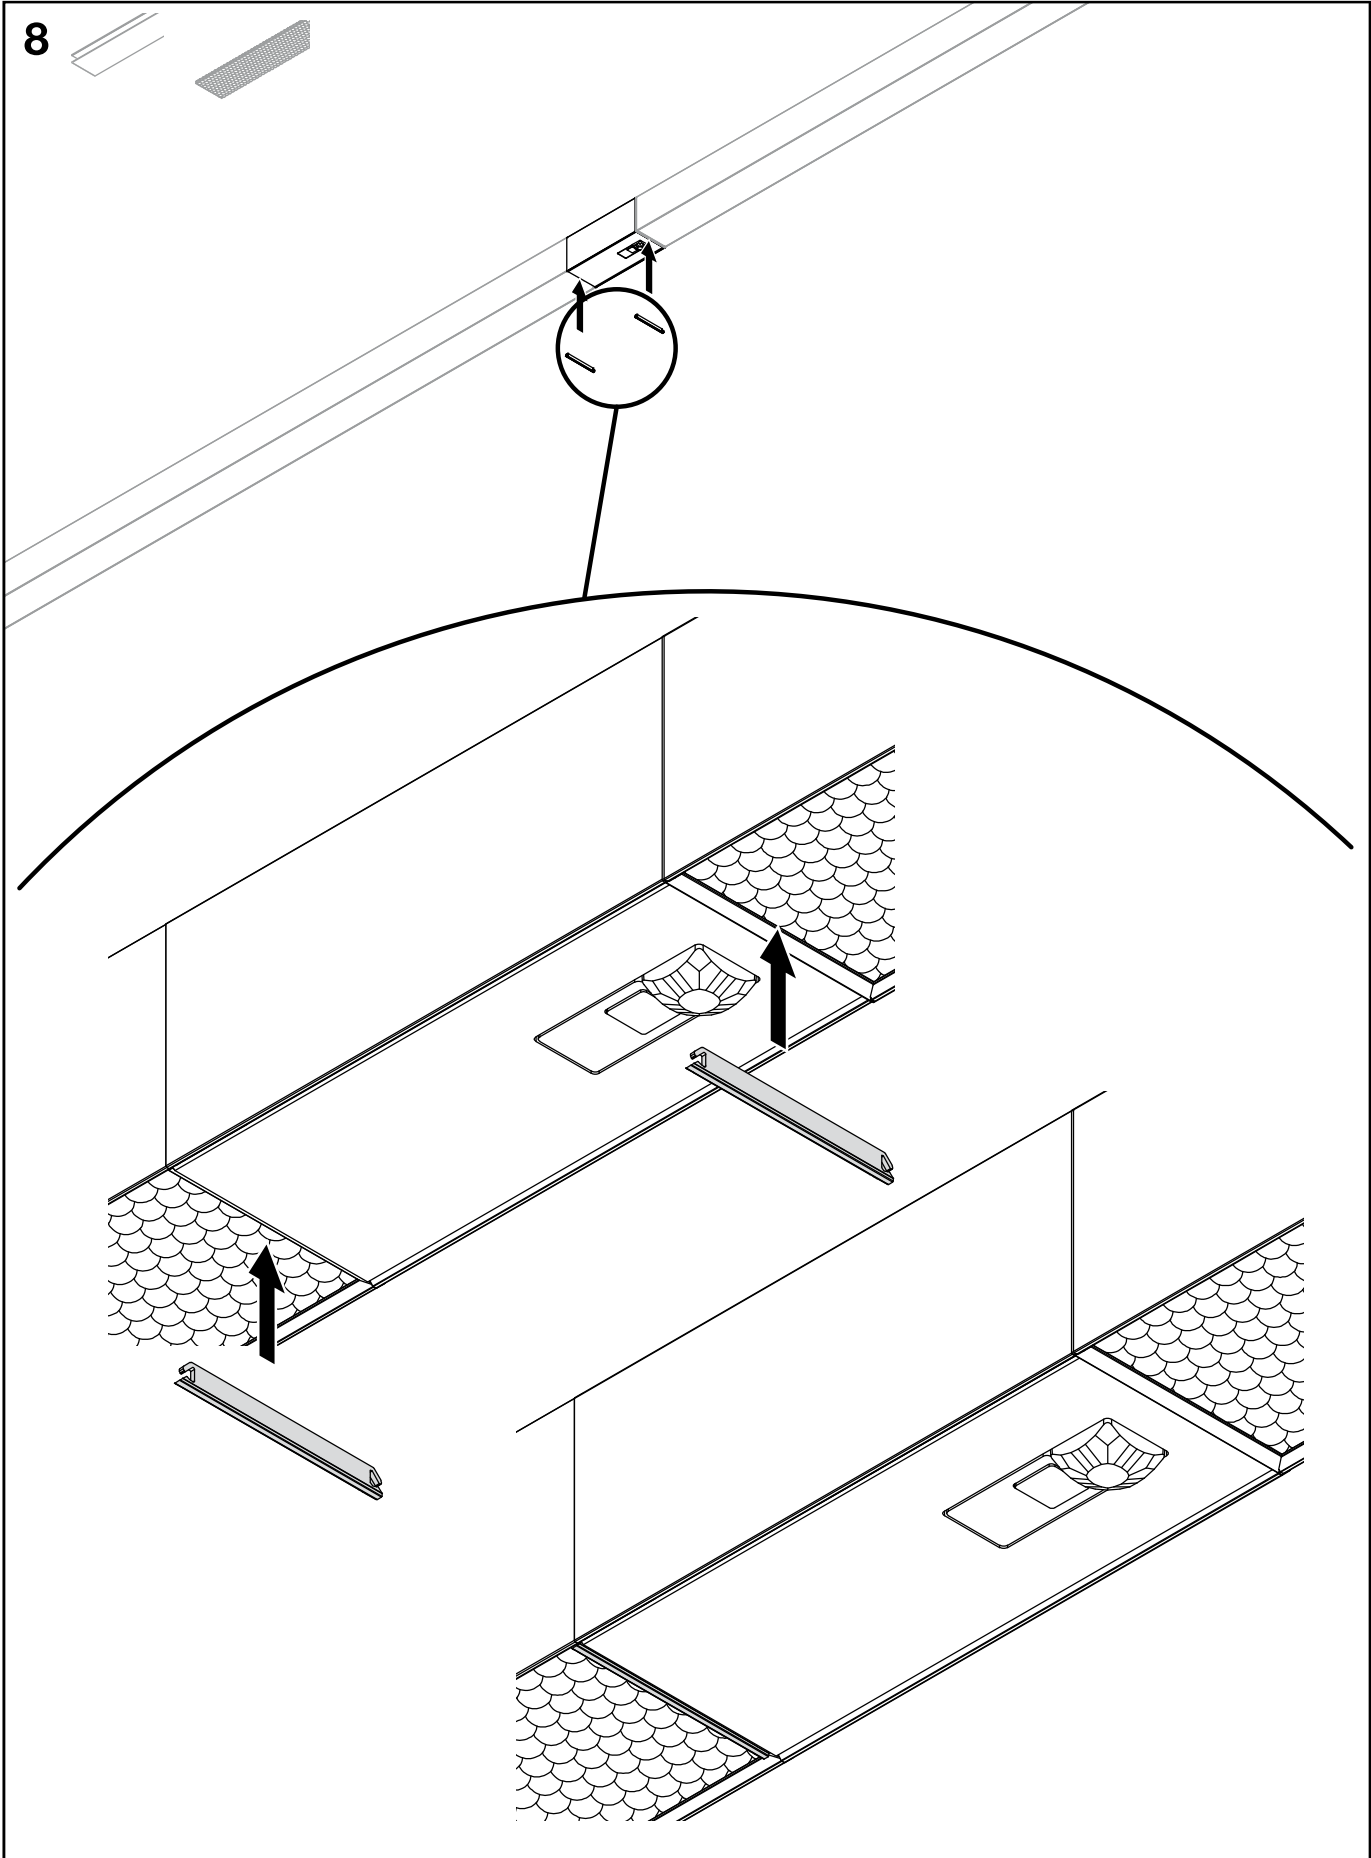

Steinel
5LZ925603



Siteco GmbH
Georg-Simon-Ohm-Straße 50
83301 Traunreut, Germany
mail: technicalsupport@siteco.de
Phone: +49 8669 / 33-844
www.siteco.com



5MA41-263238_ac
30.05.2023 / SCH